



American Energy Systems, Inc.

## TECHNICAL BULLETIN

Magnum Baby Countryside & Winchester AC/DC Models

\*\*\*Turn off power to unit and unplug before servicing.\*\*\*


### Technical Issue:

1. Cleanout plug is hard to get off inspection hole on the side of the exhaust manifold housing.
2. Combustion air clean out plug in back of ash pan housing is loose.


### Tools Needed:

Regular screwdriver

1. Cleanout plug on the side of exhaust manifold:
  - a. Open right side panel of unit. (facing the front of the unit)
  - b. Remove cleanout plug with screwdriver and discard.
  - c. Insert new cleanout plug (Part#RP2094) (supplied by dealer)
  - d. Plug power back into unit and re-light.
2. Cleanout plug in back of ash pan housing:
  - a. Open door for ash pan. Remove ash pan
  - b. Check clean out plug, if loose remove, discard and insert new one (Part# RP2094) you can get these from your nearest dealer.
  - c. Plug power back into unit and re-light.

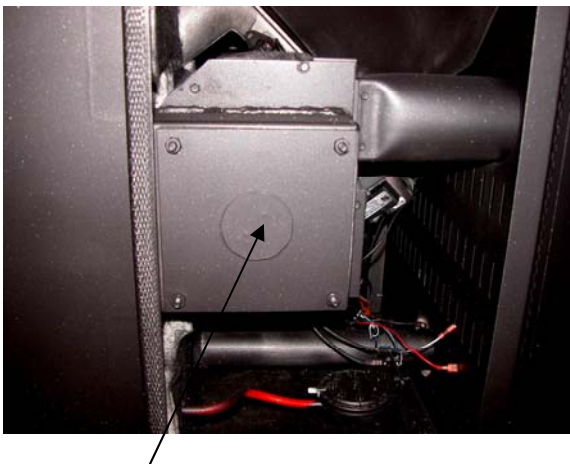

Remove plug with screwdriver and discard  
Replace with new one. Part# RP2094

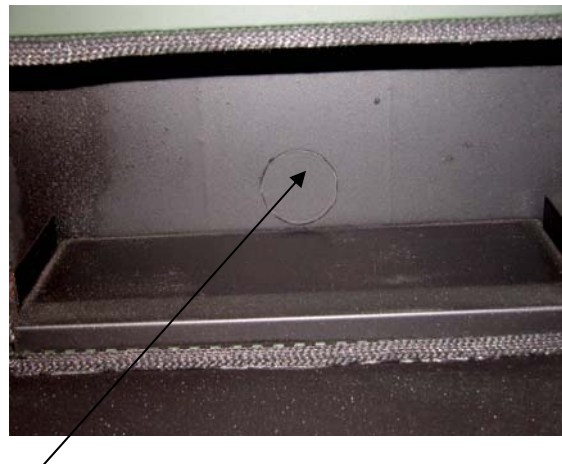

Check to see if plug is loose. If so, remove with  
screwdriver and discard this plug. Replace with  
new one. Part# RP2094